


49 state/Canada type

FUSE	A 10A	HEADLIGHT - PASSING
BI	B 10A	IGNITION-STARTER - FUEL SOLENOID
Bu/Br	C 10A	TURN SIGNAL - TAIL - HORN - BRAKE - METER
Bu/Bu	D 10A	FAN MOTOR

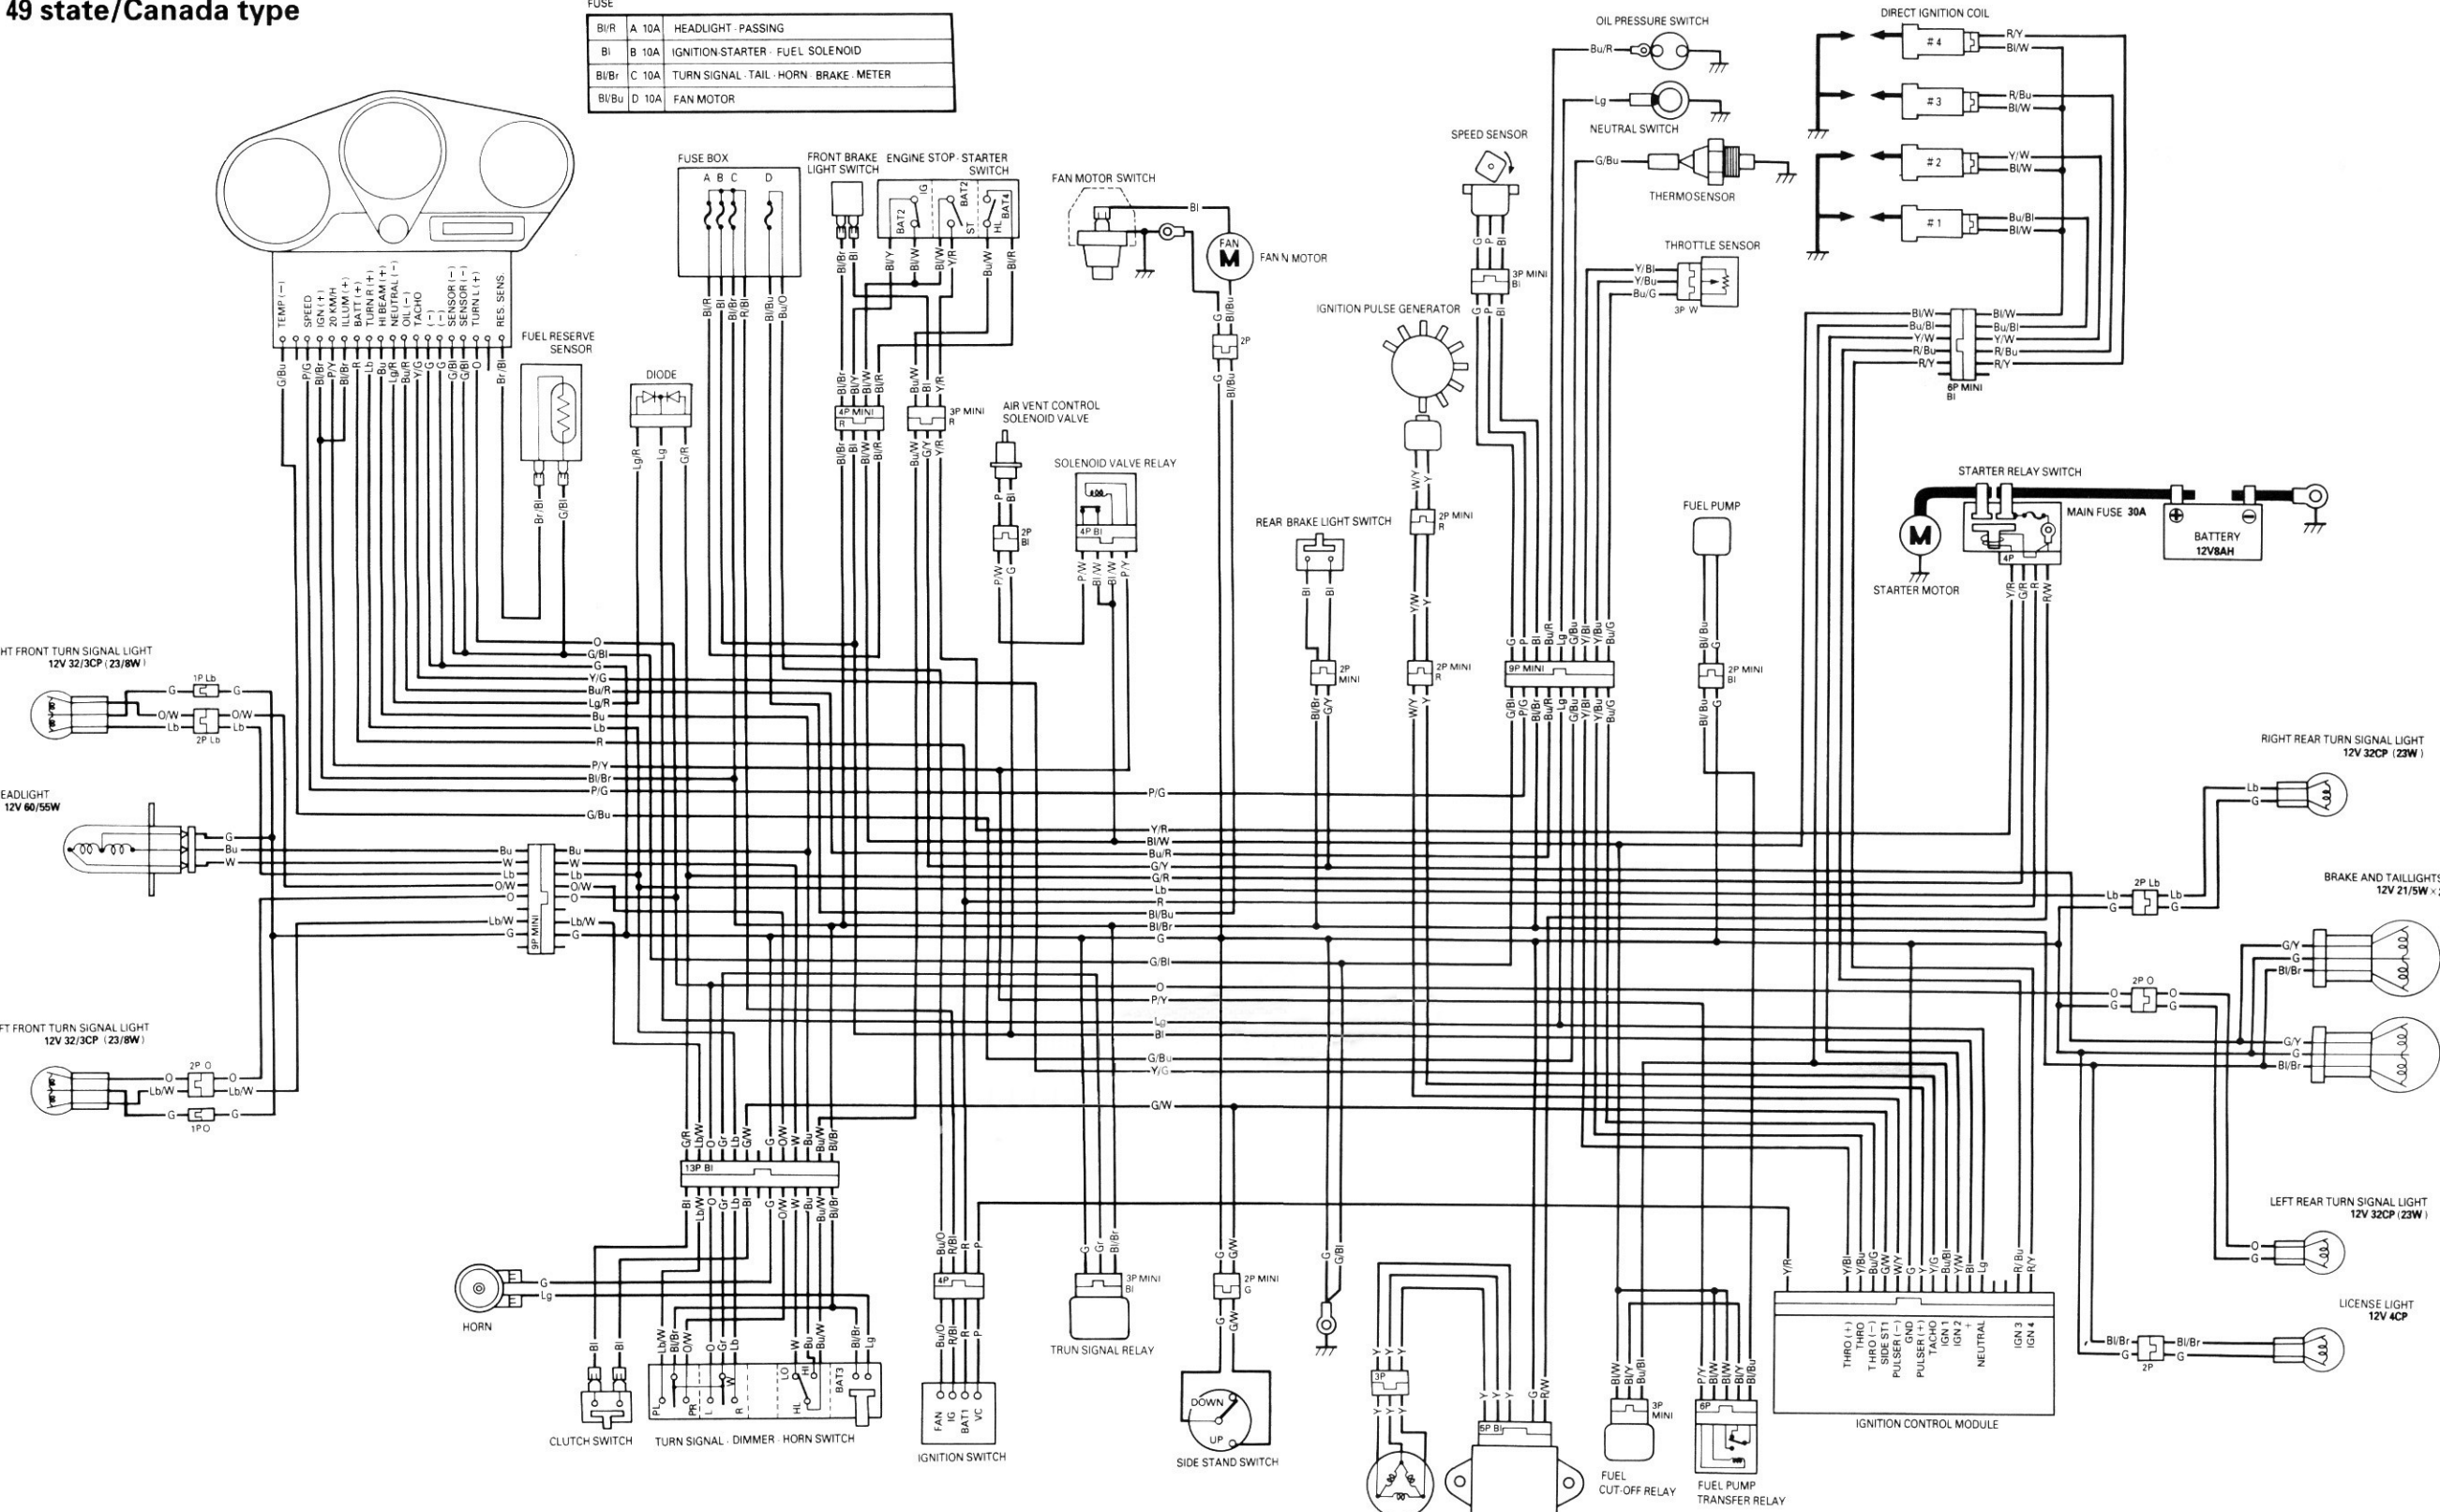

SWITCH CONTINUITY

DIMMER SWITCH		HORN SWITCH		TURN SIGNAL SWITCH				IGNITION SWITCH				ENGINE STOP SWITCH		STARTER SWITCH										
	HL	LO	HI	HO	BAT3	W	R	L	PO	PR	PL	FAN	IG	BAT1	KEY REMO-VABILITY	CONDITION OF LOCK PIN	OFF	IG	BAT2	ST	IG	BAT4	HL	
⏏	○	○	○	○	○	←	○	○	○	○	○	ON	○	○	NO	○	○	OFF	○	○	FREE	○	○	○
(N)	○	○	○	○	○	N	○	○	○	○	○	OFF	○	○	YES	○	○	○	○	○	○	○	○	○
⏏	○	○	○	○	○	→	○	○	○	○	○	LOCK	○	○	YES	OUT	○	○	○	○	○	○	○	○

- BI BLACK
- Y YELLOW
- Bu BLUE
- G GREEN
- R RED
- W WHITE
- Br BROWN
- O ORANGE
- Lb LIGHT BLUE
- Lg LIGHT GREEN
- P PINK
- Gr GRAY